

## **COMPREHENSIVE PIPELINE INSPECTION REPORT**

Project Name:		Mountain Valley Pipeline	Inspector:				Matt Grant					
Inspection Date:		Tuesday, June 19, 2018	Project Cor	ntact	: <u> </u>		Brian Clauto					
Spread:		Spread I Weather			)ry/F	Rain	): Dry					
STAGE OF CONSTRUCTION: (Check all that apply)  ☐ Clearing ☐ Rough Grading ☐ Trench Excav ☐ Backfilling and Grade Restoration ☐ Final Grading & Stabilizatio												
	SWPPP AMEND	MENTS, MODIFICATIONS AND UPD.	ATES	Yes	No	N/A	Reviewed during re-inspection? ☐Yes ☐No  Location / Description					
Is the SWPPP being amended whenever there is a change in the design, construction, operation, or maintenance that has a significant effect on the discharge of pollutants to surface waters? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, pp. 5, 6).												
2	Has the SWPPP been amended if inspections or investigations by the operator's qualified personnel or by state or federal officials find that											
3	Have there been updates to the SWPPP when any modifications to its implementation have occurred, including a record of dates when major grading activities occur, construction activities temporarily or permanently cease on a portion of the site or stabilization measures are initiated? (Va Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 5).						Upon evaluation, additional date and location information required for grading and stabilization was not included.					
4	Is there documentation in the SWPPP of replaced or modified controls? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 5)											
5		en updated to indicate areas that have re Code §62.1-44.15:31) (MVP Standards & A, p. 5).				$\boxtimes$						
	INSPECT	IONS AND CORRECTIVE ACTIONS		Yes	No	N/A	Reviewed during re-inspection?  Yes No  Location / Description					
6	frequency, including TMDL(s), and except	equired by the SWPPP been conducted a g a modified frequency for impaired water otional waters when applicable? (Va. Co andards & Specifications for VA, pp. 4, 5,	(s), approved de §62.1-									
7		rts completed and appropriately signed? IVP Standards & Specifications for VA, p		$\boxtimes$								
8	approved Annual St	ns taken consistent with the requirements tandards and Specifications? (Va. Code andards & Specifications for VA, pp. 3, 5).	§62.1-	$\boxtimes$								
	ESC AND SWM PLAN IMPLEMENTATION					N/A	Reviewed during re-inspection? ☐Yes ☐No  Location / Description					
9	accordance with the stormwater manage	uencing of the project being implemented e approved erosion and sediment control ement plans? (Va. Code §62. 1-44.15:31 ications for VA, p. 1) (9VAC25-870-54.B	plan and ) (MVP	$\boxtimes$								



10	Is topsoil segregation being carried out in accordance with the SWPPP? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, pp. 10, 11).	$\boxtimes$			
11	Have all denuded areas requiring temporary or permanent stabilization been stabilized within 7 days, and have stabilization requirements for impaired waters, approved TMDL(s), pollutants of concern and exceptional waters, when applicable, been met? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC25-870-54.B) (9VAC 25-840-40.1).	$\boxtimes$			
12	Are soil stockpiles adequately stabilized with seeding and/or protected with sediment trapping measures? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.2).		$\boxtimes$		
13	Has a permanent vegetative cover has been established that is uniform, mature enough to survive and will inhibit erosion? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, pp. 1, 15, 16) (9VAC 25-840-40.3).			$\boxtimes$	
14	Have sediment trapping facilities been constructed as the first step in land disturbance activities? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.4).		$\boxtimes$		DEQ staff determined that MP 277 Brook Mill construction entrance is not installed and is being used.
15	Have earthen structures been stabilized immediately after installation? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.5).	$\boxtimes$			Additional date information required.
16	Are sediment traps and basins installed in accordance with MS-6 and the approved plan? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.6).				
17	Are finished cut and fill slopes adequately stabilized to prevent or correct excessive erosion? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.7).			$\boxtimes$	
18	Is concentrated runoff flowing down cut or fill slopes contained in an adequate permanent or temporary structure? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.8).		$\boxtimes$		Water bars inspected not built to per the approved plan.
19	Is adequate drainage or other protection provided for water seeps? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.9).			$\boxtimes$	
20	Do all operational storm sewer inlets have adequate inlet protection? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.10).	$\boxtimes$			
21	Are stormwater conveyance channels adequately stabilized with channel lining and/or outlet protection? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.11).	$\boxtimes$			
22	Is in-stream construction conducted using measures to minimize channel damage? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.12).			$\boxtimes$	
23	Are temporary stream crossings of non-erodible material installed where applicable? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.13).	$\boxtimes$			
24	Is necessary restabilization of in-stream construction complete? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.15).			$\boxtimes$	
25	Are utility trench operations conducted and stabilized in accordance with MS-16? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.16).	$\boxtimes$			
26	Are soil and mud kept off paved or public roads to minimize the transport of sediment? (Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.17).	$\boxtimes$			
27	Have all temporary control structures that are no longer needed been removed and disturbed soil resulting from their removal permanently				



for VA, p. 1) (9VAC 25-840-40.18).				
------------------------------------	--	--	--	--



28	Are properties and waterways downstream from development adequately protected from erosion, sediment and damage in accordance with the standards and criteria specified by 9VAC25-840.19(a-n)? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.19).	$\boxtimes$			
29	Are all E&S control measures and systems being inspected, maintained and repaired as necessary to ensure functionality? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-60.A).		$\boxtimes$		
30	Are permanent control measures included in the SWPPP in place? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-54.C).				
	POLLUTION PREVENTION PLAN IMPLEMENTATION	Yes	No	N/A	Reviewed during re-inspection?  Yes No Location / Description
31	Are chemicals, fertilizers, pesticides and other potential pollutants being properly stored (e.g., under cover or within secondary containment) and handled? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC25-870-54.D).	$\boxtimes$			
32	Are construction products, materials, and wastes being properly stored, handled, and disposed of? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC25-870-54.D).	$\boxtimes$			
33	Is trash and debris being controlled and properly disposed of? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC25- 870-54.D).	$\boxtimes$			
34	Are measures in place to prevent discharge of spills or leaks from fueling, operation or storage of vehicles, motors and other mechanical equipment? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC25-870-54.D).	$\boxtimes$			
35	Have spills, leaks, or stains (e.g., from hydraulic hoses, vehicle/equipment maintenance and fueling operations, etc.) been cleaned up in accordance with the pollution prevention plan? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC25-870-54.D).				
36	Are chemicals, soaps, solvents, and wash water from construction materials or vehicle washing (e.g., form release oils and curing compounds from hand tools) prevented from leaving the site or properly treated prior to discharge? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC25-870-54.D).	$\boxtimes$			
37	Is concrete wash-out water being directed into a properly installed and maintained leak-proof container or leak-proof settling basin? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC25-870-54.D).			$\boxtimes$	
38	Are all unauthorized non-stormwater discharges prevented from leaving the site, including untreated hydrostatic testing water? Va. Code §62.1-44.15:31) (MVP Standards & Specifications for VA, pp. 1, 13) (9VAC25-870.54.D)	$\boxtimes$			



## PIPELINE INSPECTION REPORT REQUEST FOR CORRECTIVE ACTION

Project Name: <u>Mountain Valley Pipeline</u> Date: Tuesday, June 19, 2018

Location or Checklist #	Regulatory Citation/Legal requirement <sup>1</sup>	Occurrence	Observation/Recommended Corrective Action
3	(Va. Code §62.1- 44.15:31) (MVP Standards & Specifications for VA, p. 5).	1	Observation: SWPPP lacked adequate information regarding locations and dates of grading and stabilization.  Recommended Corrective Action:  Additional date and location information required for grading and stabilization.
14	(Va. Code §62.1- 44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.4).	2	Observation: MP 277 Brook Mill construction entrance was not installed and was being used.  Recommended Corrective Action: Install construction entrances per the plan.
18	(Va. Code §62.1- 44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.8).	1	Observation: Water bars inspected were not installed built per the approved plan.  Recommended Corrective Action: Install all water bars per the approved plan.
29	Va. Code §62.1- 44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-60.A).	1	Observation: Maintenance issues detected at the time of inspection included drop inlet protection.  Recommended Corrective Action: Repair all controls per the approved plan.
12	Va. Code §62.1- 44.15:31) (MVP Standards & Specifications for VA, p. 1) (9VAC 25-840-40.2).	1	Observation: Stockpiles observed during the time of the inspection lacked adequate stabilization.  Recommended Corrective Action: Adequately stabilize stockpiles per the approved plan.

Comments:			

Recommended Corrective Action Deadline: \_\_\_\_\_within 24hr notification\_\_\_\_\_\_

<sup>&</sup>lt;sup>1</sup> Refers to applicable regulation found in the most recent publication of the State Water Control Law (Va. Code § 62.1-44.2 et seq.), Virginia Erosion and Sediment Control Regulations (9VAC25-840), the Virginia Stormwater Management Program (VSMP) Regulations (9VAC25-870), or the General Permit for Discharges of Stormwater from Construction Activities (9VAC25-880).



Targeted Re-Inspection Date: \_TBD\_\_\_\_\_

The recommended corrective action deadline date applies to all conditions noted on this report unless otherwise noted. If listed condition(s) currently constitute non-compliance and/or corrective actions are not completed by the deadline, other enforcement actions may be issued to the entity responsible for ensuring compliance on the above project.

Inspector Signature:\_\_\_\_\_\_ Date: \_\_\_6-25-18\_\_\_\_\_\_

## PIPELINE INSPECTION PHOTO LOG

Project Name: Mountain Valley Pipeline Date: Tuesday, June 19, 2018

Fig. 1 Description: Inlet protection at laydown yard MVP-LY-045-046

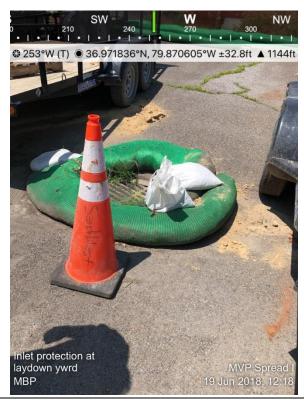


Fig. 2
Description: Topsoil stockpile with insufficient stabilization



"Photo"



Fig. 4 Description: "Photo"